



**Users Manual** 

September 2012 © 2012 Fluke Corporation. All rights reserved. Specifications are subject to change without notice. All product names are trademarks of their respective companies.

#### LIMITED WARRANTY AND LIMITATION OF LIABILITY

Each Fluke product is warranted to be free from defects in material and workmanship under normal use and service. The warranty period is one year and begins on the date of shipment. Parts, product repairs, and services are warranted for 90 days. This warranty extends only to the original buyer or end-user customer of a Fluke authorized reseller, and does not apply to fuses, disposable batteries, or to any product which, in Fluke's opinion, has been misused, altered, neglected, contaminated, or damaged by accident or abnormal conditions of operation or handling. Fluke warrants that software will operate substantially in accordance with its functional specifications for 90 days and that it has been properly recorded on non-defective media. Fluke does not warrant that software will be error free or operate without interruption. Fluke authorized resellers shall extend this warranty on new and unused products to end-user customers only but have no authority to extend a greater or different warranty on behalf of Fluke. Warranty support is available only if product is purchased through a Fluke authorized sales outlet or Buyer has paid the applicable international price. Fluke reserves the right to invoice Buyer for importation costs of repair/replacement parts when product purchased in one country is submitted for repair in another country.

Fluke's warranty obligation is limited, at Fluke's option, to refund of the purchase price, free of charge repair, or replacement of a defective product which is returned to a Fluke authorized service center within the warranty period.

To obtain warranty service, contact your nearest Fluke authorized service center to obtain return authorization information, then send the product to that service center, with a description of the difficulty, postage and insurance prepaid (FOB Destination). Fluke assumes no risk for damage in transit. Following warranty repair, the product will be returned to Buyer, transportation prepaid (FOB Destination). If Fluke determines that failure was caused by neglect, misuse, contamination, alteration, accident, or abnormal condition of operation or handling, including overvoltage failures caused by use outside the product's specified rating, or normal wear and tear of mechanical components, Fluke will provide an estimate of repair costs and obtain authorization before commencing the work. Following repair, the product will be returned to the Buyer transportation prepaid and the Buyer will be billed for the repair and return transportation charges (FOB Shipping Point).

THIS WARRANTY IS BUYER'S SOLE AND EXCLUSIVE REMEDY AND IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. FLUKE SHALL NOT BE LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES OR LOSSES, INCLUDING LOSS OF DATA, ARISING FROM ANY CAUSE OR THEORY.

Since some countries or states do not allow limitation of the term of an implied warranty, or exclusion or limitation of incidental or consequential damages, the limitations and exclusions of this warranty may not apply to every buyer. If any provision of this Warranty is held invalid or unenforceable by a court or other decision-maker of competent jurisdiction, such holding will not affect the validity or enforceability of any other provision.

Fluke Corporation P.O. Box 9090 Everett, WA 98206-9090 U.S.A. Fluke Europe B.V. P.O. Box 1186 5602 BD Eindhoven The Netherlands

11/99

# Table of Contents

# Title

# Page

	_
Introduction	.1
How to Contact Fluke Calibration	.1
Standard Equipment	
Safety Information	.2
Special Conditions for Safe Use	.3
Symbols	4
Display and Buttons	.5
Operation	.6
	.6
Engineering Units	.6
Set Auto Off	.7
Show Battery Voltage	.7
Display Actual Temperature	7
	.7
Set Damping	.7

# i

# 2700G Series

Users Manual

Set Sample Rate	.7
Set Tare	. 7
Function Lock	. 8
Supervisory Mode	. 8
Available Pressure Ranges	B
How to Set a Custom Engineering Unit or Scale	. 9
Battery Life	.9
Maintenance	.9
How to Clean the Product	.9
How to Change the Batteries	. 10
Accessories	. 11
USB Interface Cable	. 11
Power Module	. 11
Serial Interface Instructions	. 13
Initiating Communication	. 13
List of Commands	. 13
Parameter Units	. 14
Error Codes	. 15
Units Conversion	. 16
Specifications	. 18
Accuracy	. 18
Media Compatibility	. 18
Environmental	. 18
Mechanical Specifications	.19
Available Pressure Ranges	20
5	

## ii

# List of Tables

Table	Title	Page
1.	Symbols	
2.	Display and Buttons	
	Units Conversion	

#### iii

iv

# List of Figures

Figure	Title Pa	age
1.	The Product	5
2.	Change the Batteries	10
3.	The Product Change the Batteries USB Power Module and Universal Connectors	12

v

vi

#### Introduction

The 2700G Series Reference Pressure Gauges (the Product) are high-accuracy digital pressure test gauges. Accurate to 0.02 % FS, the Product can be used as a calibration reference, or in applications where high-accuracy pressure measurement is required.

The Product features user-configurable functions that include:

- Sampling rate
- Tare
- Damping
- Auto off
- Min Max

When the Product is configured, you can lock its settings and use password protection to prevent configuration changes. See the "Supervisory Mode" section.

## How to Contact Fluke Calibration

To contact Fluke Calibration, call one of the following telephone numbers:

- Technical Support USA: 1-877-355-3225
- Calibration/Repair USA: 1-877-355-3225
- Canada: 1-800-36-FLUKE (1-800-363-5853)
- Europe: +31-40-2675-200
- Japan: +81-3-6714-3114
- Singapore: +65-6799-5566
- China: +86-400-810-3435
- Brazil: +55-11-3759-7600
- Anywhere in the world: +1-425-446-6110

To see product information and download the latest manual supplements, visit Fluke Calibration's website at <u>www.flukecal.com.</u>

To register your product, visit <u>http://flukecal.com/register-product</u>.

# Standard Equipment

The Product ships with:

- Protective Cover (installed)
- Three AA Alkaline Batteries (installed)
- Safety Information (printed)
- Report of Calibration
- Manuals CD-ROM with translated Users Manuals
- USB Cable
- USB Power Adapter
- NPT to ¼ BSP Male Adapter
- NPT to M20 x 1.5 Male Adapter

# Safety Information

A **Warning** identifies conditions and procedures that are dangerous to the user. A **Caution** identifies conditions and procedures that can cause damage to the Product or the equipment under test.

## <u>∧</u>∧Warning

To prevent injury, only assemble and operate high-pressure systems if you know the correct safety procedures. High-pressure liquids and gases are hazardous and the energy from them can be released without warning.

To prevent possible electrical shock, fire, or personal injury:

- Read all safety Information before you use the Product.
- Use the Product only as specified, or the protection supplied by the Product can be compromised.
- Do not use the Product around explosive gas, vapor, or in damp or wet environments.
- Do not use and disable the Product if it is damaged.
- Remove the batteries if the Product is not used for an extended period of time, or if stored in temperatures above 50 °C. If the batteries are not removed, battery leakage can damage the Product.

#### Reference Pressure Gauge Safety Information

- Replace the batteries when the low battery indicator shows to prevent incorrect measurements.
- The battery door must be closed and locked before you operate the Product.

#### **∧**Caution

To prevent possible damage to Product or to equipment under test:

- The display reads "OL" when the pressure source is above the Product range limit. The pressure source must immediately be removed.
- Do not apply more than the maximum torque specified. Maximum torque specified is 20 Nm = 15 ft-lb.

#### Special Conditions for Safe Use

#### Misuse

If the Product is exposed to overpressure or sudden physical shock (such as being dropped) examine it for damage that can cause a safety issue. If necessary, send the Product for examination to Fluke. Refer to the How to Contact Fluke Calibration section.

#### ▲Warning

To prevent possible fire, or personal injury:

- Do not use the Product with flammable substances.
- The Product is intended for installation only in locations with protection against the entry of solid unwanted objects or water that can compromise safety.

# 2700G Series

Users Manual

# **Symbols**

Symbols used on the Product and in this manual are in Table 1.

Symbol	Meaning	Symbol	Meaning
⚠	Risk of danger. Important information. See manual.	CE	Conforms to European Union directives.
	Hazardous voltage. Risk of electrical shock.	. Es	Conforms to relevant North American Safety Standards.
<b>N</b> 10140	Conforms to relevant Australian standards.	X	This product complies with the WEEE Directive (2002/96/EC) marking requirements. The affixed label indicates that you must not discard this electrical/electronic product in domestic household waste. Product Category: With reference to the equipment types in the WEEE Directive Annex I, this product is classed as category 9 "Monitoring and Control Instrumentation" product. Do not dispose of this product as unsorted municipal waste. Go to Fluke's website for recycling information.

Table 1. Symbols

#### Reference Pressure Gauge Display and Buttons

# **Display and Buttons**

The Display and Buttons are shown in Figure 1. The Buttons are in Table 2.





Item	Function
١	Push to turn on the Product. Push again to turn off the Product.
ZERO	Zeros the display. In Configure Mode, push the button to move forward through the menus.
MIN MAX	MIN MAX records minimum and maximum pressure values and saves them to memory. Push Refer to show maximum (MAX) indication. Push again to show minimum (MIN) indication. After 2 seconds, the gauge goes back to live operation.
	To clear the MIN MAX memory values,

push and hold I for 2 seconds until CLr

backward through the menus.

is shown.

#### Table 2. Display and Buttons

Item	Function		
CONFIG	Push to go to setup and configuration menus.		
ENTER	Push to make a selection. When the Product is not in Configuration mode, push to turn on the backlight. Push again to turn off the backlight.		
1	NPT Connector		
2	Pressure Display		
3	Engineering Units		
4	Bargraph		

#### Table 2. Display and Buttons (cont.)

## **Operation**

The subsequent sections tell you how to operate the Product. Push (1) to turn on the Product.

The analog bar graph at the bottom of the display shows the applied-pressure level relative to the full range of the gauge.

#### Note

If you record a Tare value, the pressure shown is not the actual pressure applied.

#### How to Setup the Product

Before you use the product, it is necessary to configure it for your application. Push course to go to the Setup menu.

Each time course is pushed, the display goes to the subsequent function. Push  $\blacktriangle$  or  $\checkmark$  to change the parameter value. When a parameter is set, push extent to exit the configuration menu or course to move to the next parameter.

#### **Engineering Units**

The Product's default engineering unit shows psi. To change this, push  $\blacktriangle$  and  $\checkmark$  to move through the standard engineering units plus one custom unit/scale. When the necessary unit shows, push even or cover. Pressure now shows in the chosen engineering units. See the Specifications section for a list of available

#### Reference Pressure Gauge Operation

engineering units. See the Supervisory Mode section for instructions to set up custom units.

#### Set Auto Off

Auto Off can be set in 1 minute increments from 1 to 30 minutes or you can turn off the function for continuous Product operation. The Product is configured for 30 minutes. Push  $\blacktriangle$  and  $\blacktriangledown$  to set the necessary interval. The "off" position is at the low end of the selections, less than 1 minute.

#### Show Battery Voltage

Actual battery voltage and a percent-of-life bargraph show the battery charge. No adjustments are made in this parameter.

#### **Display Actual Temperature**

The Product is temperature compensated This parameter shows the temperature measured by the internal sensor. Push  $\blacktriangle$  or  $\checkmark$  to show degrees F or C.

#### Set Damping

Selections are "on"  $\blacktriangle$  and "off"  $\blacktriangledown$ . Damping smooths readings from pulsating pressure sources.

#### Set Sample Rate

This function finds how many times pressure is sampled and the display is updated. Selections are 0.5, 1, 3, and 10 samples/second. Note that 10/second gives the fastest response time.

#### Set Tare

Use this function to set a constant offset value that is then subtracted from the measured pressure. For example, if a tare is set at 30 psi, and the measured pressure is 37 psi, 7 psi is shown.

A pressure of 27 psi is shown as -3 psi.

Push  $\blacktriangle$  and  $\blacktriangledown$  to set the tare value. The value is in relation to the engineering units and resolution selected for display. Tare value can be set to the maximum range of the gauge.

For safety, the bar graph always shows the actual pressure in relation to the full range of the gauge regardless of the tare position. This is done to make sure that with a "0" reading pressure is being applied to the gauge.

#### **Function Lock**

When set, access to each of the settable parameters above can be turned "off" to prevent unauthorized configuration changes. This is done with password protection in Supervisory Mode. Push even to access Supervisory Mode or course to go back to normal operation.

#### **Supervisory Mode**

If necessary, each user-configurable parameter can be edited when you receive the Product. Some parameters are locked and must be unlocked to configure them. Use Supervisory mode to do this.

When you are in the Configure menu, and **FUnC LOCK** is shown, it means that there are locked parameters.

To disable function lock:

- 1. Push ▼ INTER. 0 PWRD is then shown.
- The password "101" is required to unlock Supervisory mode. Push ▲ to put in the password entry. Hold ▲ or ▼ down to move faster through the selections by a factor of 10. When you stop the counter, push ▲ and ▼ again to move forward or backward by a factor of 1. The password is factory set and cannot be changed.
- 3. Push ENTER.

From this point each parameter can be locked or unlocked. Push  $\blacktriangle$  and  $\blacktriangledown$  to select **UnLOC** or **LOC** for

each parameter. To move to the subsequent parameter, push control.

You can access, lock, or unlock these functions:

- Zero function (enable/disable)
- Set pressure units (enable/disable)
- Auto shutdown adjustment (enable/disable)
- Damping settings (enable/disable)
- Sample rate setting (enable/disable)
- Tare setting (enable/disable)
- Custom engineering units (set scale factor)

When a function is locked, it cannot be accessed or changed from its current condition until you go to Supervisory Mode and unlock it.

#### Available Pressure Ranges

Available pressure ranges are shown in the Specifications section.

#### Reference Pressure Gauge Battery Life

#### How to Set a Custom Engineering Unit or Scale

The last menu selection in Supervisory Mode is **SET FACTR**. You can set a multiplier factor from 0.001 to 100 to make a custom scale. The set factor is multiplied by the psi measured and the result is shown.

Example: 40 psi is the equivalent of 1000 lbs of product in a tank. It is necessary to show the product weight with a 100 psi gauge. If you set a factor of 25, 40 psi pressure shows as 1000 (40 x 25). The engineering unit shown is **Cust** (custom).

#### **Battery Life**

Battery life is approximately 75 hours of operation with the backlight off. When the battery voltage is low, the low-battery icon (a) shows on the top left of the display. To replace the batteries, see the How to Change the Batteries section.

#### Maintenance

#### How to Clean the Product

Clean the Product with a soft cloth dampened with water or water and weak soap.

#### <u>∧</u>Caution

To prevent possible damage to the Product, do not use solvents or abrasive cleansers.

#### **≜**Caution

For safe operation and maintenance of the product:

- Repair the Product before use if the battery leaks.
- Remove batteries to prevent battery leakage and damage to the Product if it is not used for an extended period.
- Be sure that the battery polarity is correct to prevent battery leakage.
- Have an approved technician repair the Product.

## How to Change the Batteries

▲ Warning To prevent possible electrical shock, fire, or personal injury, have an approved technician repair the Product.

To change the batteries, see Figure 2:

- 1. Pull off the Product cover.
- 2. Use a Phillips screwdriver to loosen the captive screw on the battery door.
- 3. Remove the battery door.
- 4. Replace the three AA batteries.
- 5. Install the battery door again.
- 6. Tighten the captive screw on the battery door.
- 7. Return the Product to its Holster.

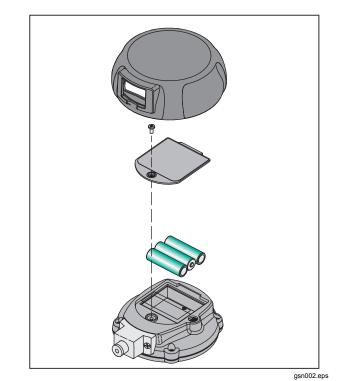


Figure 2. Change the Batteries

#### Reference Pressure Gauge Accessories

# Accessories

#### **USB Interface Cable**

The Product includes an USB interface cable. The input jack is on the back of the Product. You can use serial communication to configure and calibrate the Product and move measurement data from the Product to a PC. For specifications on the interface, see the Specifications section.

#### **Power Module**

The Product includes a USB power module. See Figure 3.

**2700G Series** Users Manual

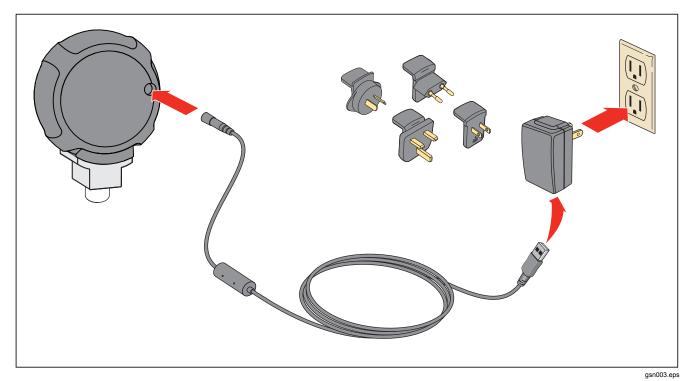


Figure 3. USB Power Module and Universal Connectors

#### **Reference Pressure Gauge** Serial Interface Instructions

# Serial Interface Instructions

The subsequent sections tell you how to set up the Product for serial communication.

#### **Initiating Communication**

Terminal communication can be setup with terminal communication Software on a PC. The terminal must be set as follows:

- Bits per second: 9600
- Data bits: 8
- Parity: None
- Stop bits: 1
- Flow control: None
- Local echo on

# List of Commands

Use the subsequent list of commands to communicate with the Gauge:

*CLS	Clears the error queue	
FAULT?	Returns an error code from the error queue	
*IDN?	Identification query. Returns the manufacturer, model number, and firmware revision level of the Calibrator.	
TARE	Tares the offset pressure of the reading on the calibrator	
TARE?	Returns the current tare value	
PRES_UNIT?	Returns the pressure unit for the upper display	
PRES_UNIT	Sets the pressure unit for the display	
ZERO_MEAS	Zeros pressure of the calibrator	
ZERO_MEAS?	Returns the current zero offset value	
MINMAX_RST	Resets the minimum and maximum recorded values	

# 2700G Series

# Users Manual

MIN?	Returns the minimum recorded value	<b>Parameter Uni</b> The subsequent list	<b>its</b> of units is used with the Product:
MAX?	Returns the maximum recorded value	psi	Pressure in pounds per square inch
TEMP?	Returns temperature in the chosen units	bar	Pressure in bars
CAL_STORE	Stores calibration data.	mBar	Pressure in millibars
CUST_MULT?	Sets the multiplier for the custom unit type	kg/cm2	Pressure in kilograms per centimeter squared
STREAM OFF	Turns off streaming data	inH2O4C	Pressure in inches of water at 4 $^\circ\mathrm{C}$
_ STREAM_ON	Turns on streaming data	inH2O20C	Pressure in inches of water at 20 °C
VAL?	Returns the measured pressure value in selected units	inH2O60F	Pressure in inches of water at 60 °F
TEMP_UNIT	Used to set temperature unit	mH2O4C	Pressure in meters of water at 4 °C
TEMP_UNIT?	Returns temperature unit	mH2O20C	Pressure in meters of water at 20 °C
		cmH2O4C	Pressure in centimeters of water at 4 $^\circ\mathrm{C}$
		cmH2O0C	Pressure in centimeters of water at 20 °C
		ftH2O4C	Pressure in feet of water at 4 $^\circ\text{C}$

ftH2O20C Pressure in feet of water at 20 °C

# Reference Pressure Gauge Error Codes

ftH2O60F	Pressure in feet of water at 60 °F
iNHg0C	Pressure in inches of mercury at 0 °C
mmHg0C	Pressure in millimeters of mercury at 0 °C
kpal	Pressure in kilopascals
Far	Temperature in Fahrenheit
Cel	Temperature in Celsius
mSW	Pressure in meters of SeaWater
ftSW	Pressure in feet of SeaWater
MPA	Pressure in MegaPascal
torr	Pressure in Torr (mmHG0C)

# **Error Codes**

The gauge uses the subsequent error codes:

101	A non-numeric entry was received where it should be a numeric entry
102	Too many significant digits entered
103	Invalid units or parameter value received
105	Entry is above the upper limit of the allowable range
106	Entry is below the lower limit of the allowable range
108	A required command parameter was missing
109	An invalid pressure unit was received
117	An unknown command was received
120	The serial input buffer overflowed
121	Too many entries in the command line
122	Pressure module not connected

# Users Manual

# **Units Conversion**

See Table 3 for units and their conversion factors.

Unit Name	Conversion Factor (from kPa)	Conversion Factor (to kPa)
psi	0.14503773773	6.894759
bar	0.01	100
MPa	0.001	1000
kgf/cm2	0.010197162130	98.06652
inH2O @ 4 °C	4.014742	0.249082
inH2O @ 20 °C	4.021845	0.248642
inH2O @ 60 °F	4.0185886	0.248844
ftH2O @ 4 °C	0.33456183	2.988984
ftH2O @ 20 °C	0.33515375	2.983705
ftH2O @ 60 °F	0.33488238	2.986123

Table 3. Units Conversion

#### Reference Pressure Gauge Units Conversion

Table 3. Units Conversion (cont.) Unit Name Conversion Factor (from kPa) Conversion Factor (to kPa) cmH2O @ 4 °C 10.19744 0.09806383 cmH2O @ 20 °C 10.21549 0.09789056 mH2O @ 4 °C 0.1019744 9.806383 mH2O @ 20 °C 0.1021549 9.789056 kPa 1 1 10 0.1 mbar inHg @ 0 °C 0.2952998 3.386387 mmHg @ 0 °C 7.500618 0.133322 Torr 7.500618 0.133322 ftSW @ 0 °C 0.325408 3.073062 mSW 0.09918444 10.08222

# Specifications

## Accuracy

Accuracy	
Positive Pressure	±0.02 % FS
Vacuum	±0.05 % FS
Temperature Compensation	18 °C to 28 °C (65 °F to 82 °F) to rated accuracy
Note: For temperatures from 0 °C to 18 °C and 28 °C to 50 °C,	add .003 % FS/°C
Media Compatibility	
15, 30 psi	any clean dry non-corrosive gas
100, 300, 500, 1000 psi	any liquids or gases compatible with 316 stainless steel
Above 1000 psi	any non-flammable, non-toxic, non-explosive, non-oxidizing liquid or gas compatible with 316 stainless steel.
Environmental	
Operating Temperature	0 °C to 50 °C (32 °F to 122 °F)
Storage	20 °C to +70 °C (-4 °F to +158 °F)
Humidity	10 % to 90 % RH Non-condensing
Altitude	2000 meters (6561.68 ft.)
Pollution Degree	2
Agency Approvals	C €, C, NOTES, @B.s

# Reference Pressure Gauge Specifications

Mechanical Specifications	
Dimensions	(11.4 x 12.7) cm, depth = 3.7 cm
	(4.5 x 5) in, depth = 1.5 in
	(Without Protective Cover)
Pressure	
Connection	¼ in NPT Male
Housing	Cast ZNAL
Display	5-1/2 Digits, 16.53 mm (0.65 in) high
	20-Segment bar graph, 0 to 100 %
Power	
Battery	three size AA alkaline batteries
Battery Life	75 hours typical without backlight

$\subset$	N
Š	02
ð	8
S	ดั
Ň	S
an	Ð
Ĕ	Z
Ø	es

# **Available Pressure Ranges**

	Model Number Pressure Range (psi) Pressure Range (MPa) Vacuum	2030- BG100K 15 0.1	2030- BG200K 30 0.2	<b>2030-</b> <b>BG700K</b> 100 0.7	2030- BG2M 300 2 -12	2030- BG3.5M 500 3.5	<b>2030-</b> <b>BG7M</b> 1000 7 7		2030- 3000 20	0 M -
1	Pressure Range (MPa)	0.1	0.2	0.7	Ν	3.5		7	7 20	20
	Vacuum Range (psi)	-15	-15	-12	-12	-12		-12	-12 0	
	Vacuum Range (kPa)	-100	-100	-80	-80	-80		-80	-80 0	
	Burst Pressure (psi)	45	90	1000	2000	2000		10000	10000 10000	
	Burst Pressure (MPa)	0.3	0.6	7	14	14		70	70 70	
	Proof Pressure (psi)	30	60	200	600	1000		2000	2000 6000	
	Proof Pressure (MPa)	0.2	0.4	1.4	4	7		14	14 40	